

## Safety Data Sheet

Company: Yamato Gokin Co., Ltd.  
 Address: 〒354-0045  
 474 Kamitome, Miyoshi-machi, Iruma-gun, Saitama-ken, Japan  
 Department: Sales  
 Contact: Head of Sales  
 Phone #: 049-273-6006  
 Fax #: 049-273-6016  
 Emergency Contact  
 Facility: Miyoshi Gokin Kogyo Co., Ltd.  
 Address: 〒354-0045  
 508 Kamitome, Miyoshi-machi, Iruma-gun, Saitama-ken, Japan  
 Department: Quality Assurance  
 Contact: Head of Quality Assurance  
 Phone #: 049-258-33 049-258-3381  
 Fax #: 049-258-52 049-258-5279

Document Creation: 2016.11.21

English Translation: 2017.09.08

**1. Product Name**

BeCu25 , BeCu165 , BeCu20C

**2. GHS Classification**

These alloys are unclassified; GHS classification information for constituent elements is listed below.

**2.1 Copper (Cu)**

Physical Hazards	Not Classified	
Health Hazards	Skin Sensitization STOT - Single Exposure	Category 1A Category 1 (digestive organs) Category 3 (respiratory irritation)
Environmental Hazards	Not Classified	

GHS Label Elements  
Pictogram

Signal Word	Danger / Warning
Hazard Statements	H317: May cause an allergic skin reaction H335: May cause respiratory irritation H370: Causes damage to organs (digestive organs)

Precautionary Statements

Safety Measures	Minimize generation and build-up of dust particles. Do not inhale dust / fumes. Wash thoroughly after handling. Do not eat, drink or smoke when using this product. Contaminated work clothing must not be allowed out of the workplace. Wear protective gloves/protective clothing/eye protection/face protection. In case of inadequate ventilation wear respiratory protection.
-----------------	--

Emergency Measures	<p>IF ON SKIN: Wash with plenty of water.</p> <p>IF INHALED: Remove victim to fresh air and keep at rest in a position comfortable for breathing.</p> <p>IF exposed or concerned: Call a doctor.</p> <p>If skin irritation or rash occurs: Get medical advice/attention.</p> <p>If experiencing respiratory symptoms: Call a doctor.</p> <p>Wash contaminated clothes before reusing.</p>
--------------------	---

Storage	Store locked up.
---------	------------------

Risks not covered by GHS classification	None known
---	------------

## 2.2 Beryllium (Be)

Physical Hazards	Not Classified	
Health Hazards	Respiratory sensitization Skin sensitization Carcinogenicity STOT – single exposure STOT – repeat exposure	Category 1 Category 1 Category 1A Category 1 (respiratory organs) Category 1 (respiratory organs)
Environmental Hazards	Aquatic environmental chronic toxicity	Category 4

GHS Label Elements  
Pictogram



Signal Word	Danger / Caution
-------------	------------------

Hazard Statements	<p>H334: May cause allergy or asthma symptoms or breathing issues if inhaled</p> <p>H317: May cause an allergic skin reaction</p> <p>H350: May cause cancer</p> <p>H370: Causes damage to organs (respiratory organs)</p> <p>H372: Causes damage to organs through prolonged or repeated exposure (respiratory organs)</p> <p>H413: May cause long-lasting harmful effects to aquatic life</p>
-------------------	--


Precautionary Statements Safety Measures	<p>Minimize generation and build-up of dust particles.</p> <p>Do not inhale dust / fumes.</p> <p>Wash thoroughly after handling.</p> <p>Do not eat, drink or smoke when using this product.</p> <p>Contaminated work clothing must not be allowed out of the workplace.</p> <p>Wear protective gloves/protective clothing/eye protection/face protection.</p> <p>In case of inadequate ventilation wear respiratory protection.</p>
---	---

Emergency Measures	<p>IF ON SKIN: Wash with plenty of water.</p> <p>IF INHALED: Remove victim to fresh air and keep at rest in a position comfortable for breathing.</p> <p>IF exposed or concerned: Call a doctor.</p> <p>If skin irritation or rash occurs: Get medical advice/attention.</p> <p>If experiencing respiratory symptoms: Call a doctor.</p> <p>Wash contaminated clothes before reusing.</p>
--------------------	---

Storage	Store locked up.
---------	------------------

Risks not covered by GHS classification	None known
---	------------


## 2.3 Cobalt (Co)

Physical Hazards	Not Classified	
Health Hazards	Respiratory sensitization Skin sensitization Carcinogenicity STOT – single exposure STOT – repeat exposure	Category 1 Category 1 Category 2 Category 3 (respiratory irritation) Category 1 (respiratory organs)
Environmental Hazards	Not Classified	
GHS Label Elements Pictogram		
Signal Word	Danger / Warning	
Hazard Statements	H334: May cause allergy or asthma symptoms or breathing difficulties if inhaled H317: May cause an allergic skin reaction H351: Suspected of causing cancer H335: May causing respiratory irritation H372: Causes damage to organs through prolonged or repeated exposure (respiratory system, cardiovascular system, thyroid, blood)	
Precautionary Statements Safety Measures	Minimize generation and build-up of dust particles. Do not inhale dust / fumes. Wash thoroughly after handling. Do not eat, drink or smoke when using this product. Contaminated work clothing must not be allowed out of the workplace. Wear protective gloves/protective clothing/eye protection/face protection. In case of inadequate ventilation wear respiratory protection.	
Emergency Measures	IF ON SKIN: Wash with plenty of water. IF INHALED: Remove victim to fresh air and keep at rest in a position comfortable for breathing. IF exposed or concerned: Call a doctor. If skin irritation or rash occurs: Get medical advice/attention. If experiencing respiratory symptoms: Call a doctor. Wash contaminated clothes before reusing.	
Storage	Store locked up.	
Risks not covered by GHS classification	None known	

## 2.4 Silicon (Si)

Physical Hazards	Flammable solid	Category 2
Health Hazards	Eye irritant	Category 2B
Environmental Hazards	Not Classified	

GHS Label Elements  
Pictogram

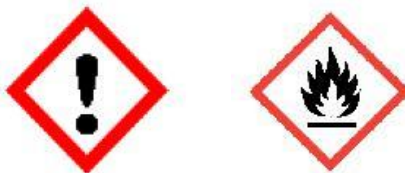

Signal Word	Warning
Hazard Statement	H228: Flammable Solid H320: Causes eye irritation
Precautionary Statements Safety Measures	Wear protective gloves/protective clothing/eye protection/face protection. Wash thoroughly after handling.
Emergency Measures	IF ON SKIN: Wash with plenty of water.
Storage	Store locked up.

Risks not covered by GHS classification                      None known

## 3. Composition / Information on Ingredients

Classification	: Mixture
Chemical Name	: BeCu25 & BeCu165 : Copper-Beryllium-Cobalt Alloy : BeCu20C : Copper-Beryllium-Cobalt-Silicon Alloy

Hazardous Ingredients :  
Names and composition (mass%) of Class 1 Designated Chemical Substances as per the "Law Concerning Reporting, etc. of Releases to the Environment of Specific Chemical Substances and Promoting Improvements in Their Management" (PRTR Law)

	Cu	Be	Co	Si
Item	Copper	Beryllium	Cobalt	Silicon
BeCu25 Composition	bal.	1.80~2.0	0.2~0.35	-
BeCu165 Comp.	bal.	1.6~1.80	0.2~0.35	-
BeCu20C Comp.	bal.	1.9~2.2	0.35~0.65	0.2~0.35
Government No.	N/A	394(1)	132	N/A
CAS No.	7440-50-8	7440-41-7	7440-48-4	7440-21-3

(1) Specific Class 1 Designated Chemical Substance

#### 4. First-Aid Measures

- Damage from fumes or dust
  - Immediately remove victim to fresh air.
  - If victim has trouble breathing, assist with breathing and seek medical attention.
- Eye contact
  - If foreign matter enters the eyes, do not rub. Wash out eyes with plenty of water.
  - If irritation persists, seek medical attention.
- Skin contact
  - Brush off foreign matter with hands and wash the affected area well with water.
  - If irritation persists, seek medical attention.

#### 5. Fire-Fighting Measures

Not applicable (non-combustible)

#### 6. Accidental Release Measures

Product is a solid, so accidental release / spillage is not a concern under normal environmental conditions.

#### 7. Handling and Storage

- No special handling needed, though wearing gloves is recommended when handling products with sharp corners and edges.
- In high-humidity locations, store product indoors.

#### 8. Exposure Controls / Personal Protection

Melting, casting, cutting, thermal cutting and grinding are classified as "dusty work" according to the "Ordinance on Prevention of Hazards Due to Dust," and must be managed accordingly.

- Keep source of dust sealed, or install local exhaust ventilation system
- Wear respiratory protective equipment
- Periodically clean up accumulated dust
- If dust gets on work clothes, clean clothes by washing
- Wash hands and gargle after working

Permissible Exposure Limit

Material	Form	Permissible Density (mg/m <sup>3</sup> )	
		Japan Society for Occupational Health	ACGIH
Cu	Fumes	—	0.2
	Dust and mist (as Cu)	—	1
Be	Particles	0.002	0.002
Co	Particles	0.05	0.02
Si	Particles	—	10

#### 9. Physical and Chemical Properties

	BeCu25	BeCu165	BeCu20C
Appearance	: Metallic	Metallic	Metallic
Color	: Copper-gold	Copper-gold	Copper-gold
Relative Density	: 8.36	8.41	8.09
Boiling Point	: N/A	N/A	N/A
Melting Point	: 870°C	870°C	980°C
Solubility	: Not soluble in water	Not soluble in water	Not soluble in water
Odor	: Odorless	Odorless	Odorless

## 10. Stability and Reactivity

- Stable under normal handling conditions.
- Contact with acid or similar chemical substance may produce hydrogen gas.

## 11. Toxicological Information

- Acute Toxicity
  - Inhaling dust particles from fumes, etc. may induce the following: cough, chest pain, fever.
- Chronic Toxicity
  - Inhaling dust particles from fumes, etc. may induce the following: pneumoconiosis.
- Carcinogenicity

Beryllium and Be compounds		
Japan Society for Occupational Health	:	2A
ACGIH	:	A1
Cobalt		
Japan Society for Occupational Health	:	2B
ACGIH	:	A3

## 12. Ecological Information

- No data on the ecological effects of this product is currently available.

## 13. Disposal Considerations

- Dispose of product in an environmentally conscious and appropriate manner. Disposal must be in accordance with all applicable industrial waste regulations, including prefectural and municipal requirements.

## 14. Transport Information

- None in particular. During sea transport, minimizing the product's exposure to sea water is recommended.

## 15. Applicable Regulatory Laws

- Law Concerning Reporting, etc. of Releases to the Environment of Specific Chemical Substances and Promoting Improvements in Their Management
- Industrial Safety and Health Law

## 16. Other Information

The information on this data sheet was compiled based on our current knowledge and available documentation. It may be replaced in the event that new information becomes available. Furthermore, the precautions presented herein apply only to normal handling of the product, and do not constitute a guarantee of safety.

### Cited References

Handbook of Industrial Poisoning (Ishiyaku Publishers Inc.)  
Hazardous Materials Handbook (Maruzen Publishing Co., Ltd.)  
Metals Data Book (Maruzen Publishing Co., Ltd.)  
NITE Chemical Information Risk Platform (CHRIP)